


QuickDraw has the functionality to blow out the sprayer hose at the completion of a batch or recipe. Once the batch has finished and the water supply valves have closed, the air purge valve opens for a user settable time in order to blow out the hose and make handling the sprayer hose easier.

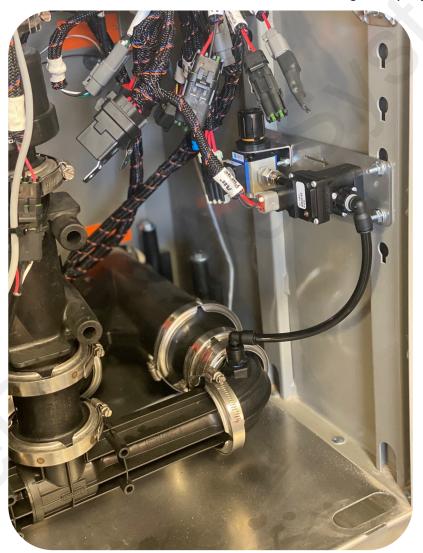





Page 1 © 2020-2022 SurePoint Ag Systems, Inc.



606-03-300150 - QuickDraw Air Purge Kit (MY2021 and Newer) Parts List & Installation Instructions

| ITEM | PART NUMBER | DESCRIPTION | QTY. |
|------|------------------|--|------|
| 1 | 103-4496Y1 | Zip Valve 1/4" Nylon, 2-way, SS Ball, 3/8" Push to Connect | 1 |
| 2 | 113-12-038038 | Stem Elbow - 3/8" Stem x 3/8" QC | 2 |
| 3 | 137-MGR200-08L | Air Pressure Regulator w/ 60 psi Gauge – ¼" NPT Inlet/Outlet | 1 |
| 4 | 304-040012-5 | Carriage Bolt - 1/4" x 3/4" G5 | 4 |
| 5 | 323-04 | 1/4" Flange Nut | 4 |
| 6 | 330-1024 | Size 10 Flat Washer | 2 |
| 7 | 340-100012 | Machine Screw - Size 10 x 3/4" | 2 |
| 8 | 385-043-AP1 | Bulk 3/8" Tubing | 1 |
| 9 | 385-50-038025-CZ | 3/8" Tube to 1/4 NPT Straight - Pneumatic Fitting | 1 |
| 10 | 385-51-038025-CZ | 3/8" Tube to 1/4 NPT 90 Elbow - Pnuematic Fitting (Not Used) | 1 |
| 11 | 475-4852Y1 | QuickDraw Air Purge Regulator/Valve Mounting Bracket | 1 |
| 12 | 757-97349A200 | Size 6 Thread Forming Screw for Plastic - SS | 3 |

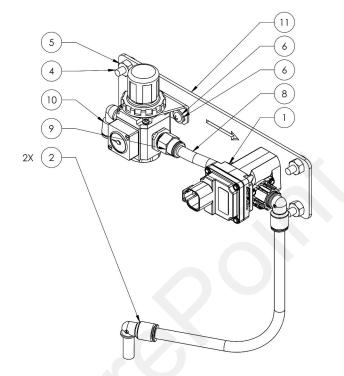

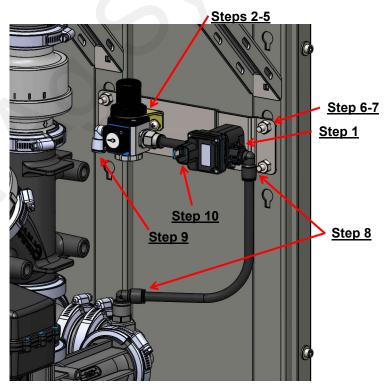

Assembly Instructions for MY2021 and newer:

Note: For ease of access, it is recommend to remove the back QuickDraw door.


- 1. Mount the electric on/off valve to mounting bracket using (3) Size 6 Thread Forming Screws
- 2. Install 1/4" MPT x 3/8" fittings into the Air Pressure Regulator as shown.
- 3. Cut 3/8" Pneumatic tubing to approximately 3-3/4" and install in zip valve.
- 4. Push to connect the air regulator to the tube.
- 5. Mount the Air Pressure Regulator to the mounting bracket using the Size 10 machine screw, flat washer and nylock.
- 6. Loosely install 1/4" flange nuts onto the carriage bolts.
- 7. Slide assembly in Battery Tray key slots and tighten flange nuts.
- 8. Install 3/8" Stem x HB fittings in the outlet of the Zip Valve and into the check valve in the QuickDraw Main Plumbing assembly, in the 2" full port sweep fitting. (*This step is not applicable to QuickDraw Max Suction, see page 3*)
- 9. Connect air supply to the pressure regulator inlet fitting and set the Air Pressure Regulator to 20-25 PSI.
- 10. Plug the "Air Purge" connector in the main QuickDraw Harness into the air supply valve (4-Pin Deutsch Connector).

396-4876Y1 - QuickDraw 3000 Air Purge Installation Manual Page 2 © 2020-2022 SurePoint Ag Systems, Inc.



606-03-300160 - QuickDraw^{MAX} Suction Air Purge Kit Parts List & Installation Instructions

| ITEM NO. | PART NUMBER | DESCRIPTION | QTY. |
|-------------|------------------|--|------|
| 1 | 103-4496Y1 | Zip Valve 1/4" Nylon, 2-way, SS Ball, 3/8" Push to Connect | 1 |
| 2 | 113-12-038038 | Stem Elbow - 3/8" Stem x 3/8" QC | 2 |
| 3 | 137-MGR200-08L | Air Pressure Regulator w/ 60 psi Gauge – ¼" NPT Inlet/Outlet 🥢 | 1 |
| 4 | 304-040012-5 | Carriage Bolt - 1/4" x 3/4" G5 | 4 |
| 5 | 323-04 | 1/4" Flange Nut | 4 |
| 6 | 330-1024 | Size 10 Flat Washer | 2 |
| 7 | 340-100012 | Machine Screw - Size 10 x 3/4" | 2 |
| 8 | 385-043 | Bulk 3/8" Tubing | 20ft |
| 9 | 385-50-038025-CZ | 3/8" Tube to 1/4 NPT Straight - Pneumatic Fitting | 1 |
| 10 | 385-51-038025-CZ | 3/8" Tube to 1/4 NPT 90 Elbow - Pneumatic Fitting | 1 |
| 11 | 475-4852Y1 | QuickDraw Air Purge Regulator/Valve Mounting Bracket | 1 |
| 12 | 757-97349A200 | Size 6 Thread Forming Screw for Plastic - SS | 3 |
| 13 | 757-2048N11 | QD Check Valve - 1/4" MPT x 3/8" QC | 1 |
| 14 | 105-300CPG-038 | 3" Manifold Coupling with 3/8" Tap | 1 |
| 15 | 100-038025RB | 3/8" MPT x 1/4" FPT Reducer Bushing | 1 |
| 16 | 105-FC300 | 3" Manifold Clamp | 1 |
| 17 | 105-300G-H | 3" EPDM Manifold Gasket | 1 |

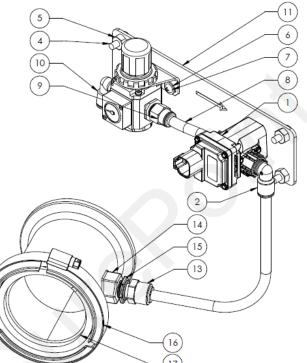

Steps 1-7 Steps 1-7 Step 4 Step 4 Step 3

Note: Installing air purge connection downstream of the pump with a check valve will mitigate priming issues.

Assembly Instructions for QuickDraw^{MAX} Suction:

Note: For ease of access, it is recommend to remove the back QuickDraw door.


- 1. Follow Steps 1-7 from previous page to mount the air purge assembly in the QuickDraw cabinet.
- 2. Install 3/8" Stem x HB fittings in the outlet of the Zip Valve and install the tapped 3" coupler with 3/8" check valve installed in the desired location downstream of the pump.
- 3. Connect air supply to the pressure regulator inlet fitting and set the Air Pressure Regulator to 20-25 PSI.
- 4. Plug the "Air Purge" connector in the main QuickDraw Harness into the air supply valve (4-Pin Deutsch Connector).


Page 3 © 2020-2022 SurePoint Ag Systems, Inc.



606-03-300175 - QuickDraw Air Purge Retrofit Kit Parts List & Installation Instructions

| ITEM NO. | PART NUMBER | DESCRIPTION | QTY. |
|-------------|------------------|--|------|
| 1 | 103-4496Y1 | Zip Valve 1/4" Nylon, 2-way, SS Ball, 3/8" Push to Connect | 1 |
| 2 | 113-12-038038 | Stem Elbow - 3/8" Stem x 3/8" QC | 2 |
| 3 | 137-MGR200-08L | Air Pressure Regulator w/ 60 psi Gauge – ¼" NPT Inlet/Outlet | 1 |
| 4 | 304-040012-5 | Carriage Bolt - 1/4" x 3/4" G5 | 4 |
| 5 | 323-04 | 1/4" Flange Nut | 4 |
| 6 | 330-1024 | Size 10 Flat Washer | 2 |
| 7 | 340-100012 | Machine Screw - Size 10 x 3/4" | 2 |
| 8 | 385-043-AP1 | Bulk 3/8" Tubing | 1 |
| 9 | 385-50-038025-CZ | 3/8" Tube to 1/4 NPT Straight - Pneumatic Fitting | 1 |
| 10 | 385-51-038025-CZ | 3/8" Tube to 1/4 NPT 90 Elbow - Pnuematic Fitting (Not Used) | 1 |
| 11 | 475-4852Y1 | QuickDraw Air Purge Regulator/Valve Mounting Bracket | 1 |
| 12 | 757-97349A200 | Size 6 Thread Forming Screw for Plastic - SS | 3 |
| *13 | 208-05-4863Y1 | QuickDraw Adapter Aux Output to Air Purge | 1 |
| *14 | 105-220SWPG90 | 2" Manifold Sweep with 1/4" Gauge Port - 90 Degree | 1 |
| *15 | 757-2048N11 | QD Check Valve - 1/4" MPT x 3/8" QC | 1 |
| | | | |

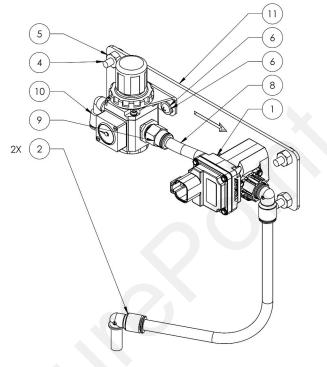

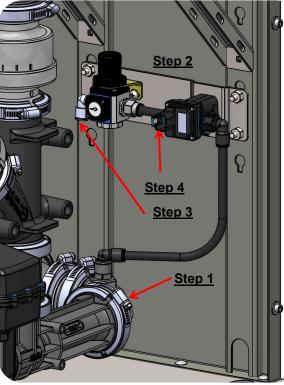

- Assembly Instructions for QuickDraw 3000 units sold prior to 2021: 1. Replace the 2" full port manifold sweep with the new gauge port sweep and use pipe thread sealant to install the 1/4" MPT x 3/8" QC Check Valve into the gauge port. Re-use the existing clamps and gaskets.
- 2. Follow the instructions from the previous pages for the installation of the Air Purge Assembly.
- 3. Connect air supply to the pressure regulator inlet fitting and set the Air Pressure Regulator to 20-25 PSI.
- 4. Plug the 208-04-4863Y1 QuickDraw Adapter Aux Output to Air Purge into the 6-pin Deutsch connector in the harness connector labeled "Aux" and plug into the air supply valve (4-pin DT).
- 5. A software update will be required for adding the Air Purge feature to QuickDraw units sold prior to 2021. Follow the instructions in the QuickDraw manual for downloading and installing the latest versions of software incorporating the Air Purge functionality.

396-4876Y1 - QuickDraw 3000 Air Purge Installation Manual



Air Purge Controller Setup

| | Sy | /stem Se | etting | s 2 | ? | |
|--|------------|--------------|---|--|--|--------------------|
| Product Valve | Close Time | Boost Pu | ump | Displa | y Sleep 📿 🗸 🤇 | |
| Valve 1 🗸 🔿 | 3.20 Sec | DISABLED | | S | leep Time 10 N | /lin |
| Valve 2 🗸 🗸 🔿 | 1.50 Sec | Dunne T | | la sative Chu | | |
| Valve 3 🗸 🗸 🔿 | 1.50 Sec | Purge T | ime Sec | Inactive Shu | | |
| Valve 4 🗸 🔿 | 1.50 Sec | | | | own Time 60 N | /lin |
| Valve 5 🗸 🗸 🔿 | 1.50 Sec | | | | | |
| Valve 6 🛛 🗸 🔘 | 1.50 Sec | • (| the comple Outlet hose requiring di | sired time for the air tion of the QuickDra size and length wi fferent durations of Purge Time to 0.0 | aw batch. Il vary by applica the purge valve | ition, being op |
| | | | | | < | |
| | | | | Remote | | |
| | | | | Settings R | UN MENU | |
| | | | | 7 | | |
| | Ν | Manual C | Contro | ls | | |
| Carrier Flow | | | SET | | | |
| 1497.7 GAL | | | | | • FOSHION | |
| 0.0 GPM | Valve 1 | | | 0 0 | 0 | |
| RESET | Valve 2 | | | 0 0 | 0 | |
| Mass Meter Flow | Valve 3 | | | 0 0 | 0 | |
| 274.4 GAL | Valve 4 | | | 0 0 | 0 | |
| 0.0 GPM RESET | Valve 5 | | | 0 0 | 0 | |
| RESET | | | | | | |
| Pressure: 0.0 PSI | | | | | | |
| PRODUCT HOSE RINSE DISABLED | 2 Inch | 3 Inch Valve | Rinse | Start Pump Start I | Boost | |
| MASS METER DATA | - | | | Kill Pump Start I | Purge | |
| III IOO METER DAIA | 11 | 11 | | and the second sec | RUN | |
| The purge valve can Controls screen and | | | | | | RUN |



Air Purge Operation

If Purge is enabled, upon Batch completion the QuickDraw will close all the valves. This takes approximately 6 seconds. While the valves are closing, the indicator light on the top of the QuickDraw will flash and the following screen will be visible:

| Purge | 2 |
|---|-----------|
| Closing Carrier Valve Purge Time 5.0 Sec | |
| Setpoint entered on the 'Setting | s 2' page |
| CANCEL | |

After the valves are closed, the purge valve will open. While the purge valve is open the indicator light on the top of the QuickDraw will be on (not flashing) and the following screen will be visible:

| Purge |
|------------------------------------|
| Purge Active Purge Time 3.1 Sec |
| Purge Time remaining (countdown) |
| CANCEL |

The Purge Time will count down, indicating how long the purge valve will remain open. When the purge cycle is complete, the indicator light on the top of the QuickDraw will turn off.