

396-5098Y1


Great Plains BD7600-30

Sure Point 400 Gallon Tank Mounting Instructions

Drill Manufacturer:

Kit Number: 551-04-300400

Description: Great Plains BD7600-30 400 Gallon Tank Kit

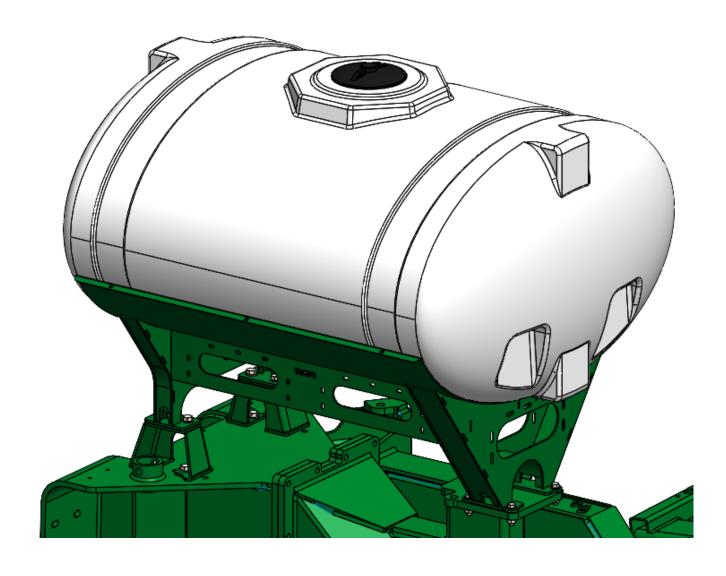




Parts List and Installation Dimensions

551-04-300400

400 Gallon Elliptical Tank Kit

ITEM	PART NUMBER	DESCRIPTION	QTY.
1	300-100208-5	5/8" x 2-1/2" Hex Head Bolt - G5	4
2	300-120200-5	3/4" x 2" Hex Head Bolt - G5	4
3	300-120208-5	3/4" x 2-1/2" Hex Head Bolt - G5	4
4	323-10	5/8" Flange Nut	4
5	323-12	3/4" Flange Nut	8
6	330-10	5/8" Flat Washer	4
7	330-12	3/4" Flat Washer	8
8	396-5097Y1	Great Plains Tank Mounting Instructions	1
9	450-5093Y1	Great Plains BD7600 26 Foot 400 Gal Tank Bracket	1
10	450-5096Y1	Great Plains BD7600 30 Foot - Pedestal	2
11	525-3000	3" Tank Strap Kit for 400 - 500 Gallon Tanks	1
12	727-01-HE0400-75-W	Elliptical Tank - 400 Gal - White	1

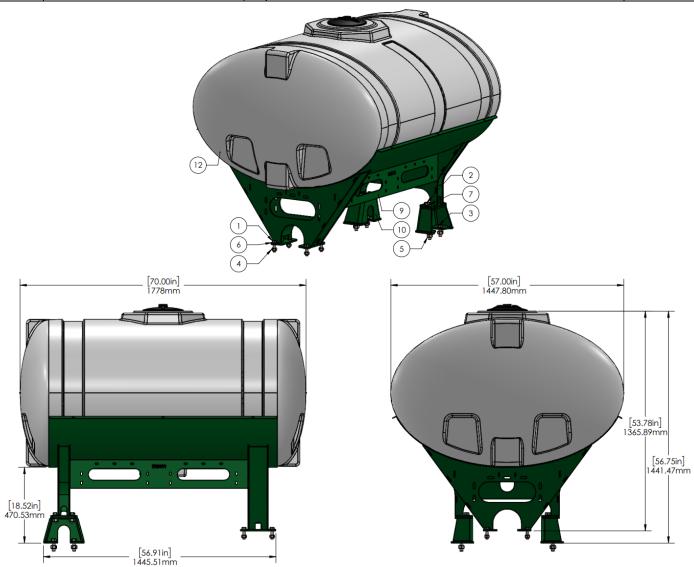



396-5098Y1 - Great Plains BD7600-26 Mounting Instruction Sheet

Page 2 © 2022 SurePoint Ag Systems, Inc.



Loosely mount both 450-5096Y1 - BD7600 30
Foot 400 Gallon Tank Pedestals to the bolt
plate on the hitch using four (4) 3/4" x 2-1/2"
hex head bolts, washers, and flange nuts.
Install edge guard and check hydraulic hoses
for clearance and rubbing. Re-secure or
reroute hydraulic hoses as needed.

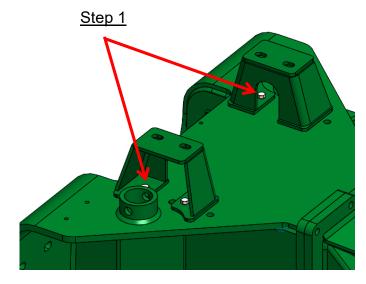


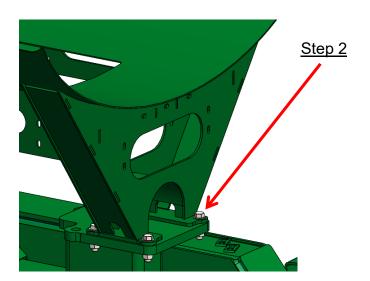

2. Loosely mount the front of 450-5093Y1 - 400 Gallon Tank Bracket to the bolt plate on the hitch using four (4) 5/8" x 2-1/2" hex head bolts, washers, and flange nuts.


3. Loosely mount the back of 450-5093Y1 - 400 Gallon Tank Bracket to both 450-5096Y1 Pedestals to the bolt plate on the hitch using four (4) 3/4" x 2-1/2" hex head bolts, washers, and flange nuts.



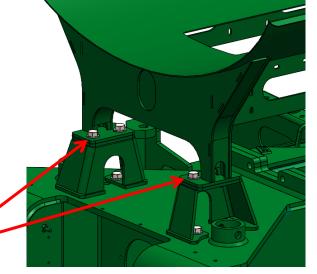




4. Once bolts and holes line up, tighten all mounting bracket bolts.

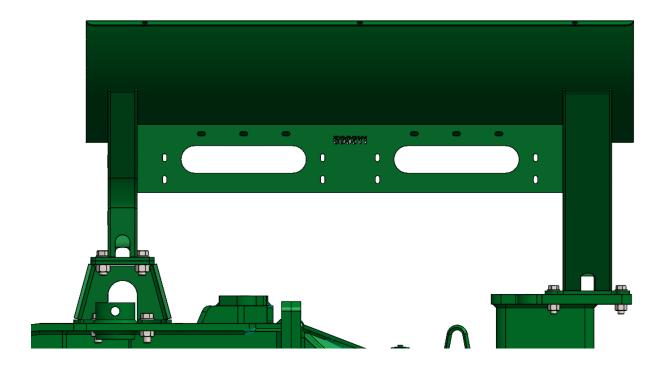

5. Finally, install the tank in the saddles and fasten the tank strap mounting brackets, and tank straps. Check for clearance from seed boxes when folding and when the drill is raised and lowered. Note: Tighten straps again once the tank has been filled.

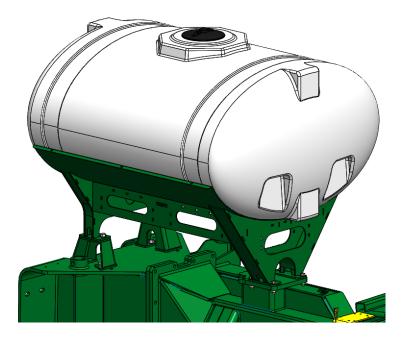

Page 4 © 2022 SurePoint Ag Systems, Inc.



Suggested Items

Kit Number: XXX-XXXXXX


Kit Description: Great Plains Gauge Extension / Section Valve Bracket


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	300-050100-5	5/16" x 1" Hex Head Bolt - G5	2
2	323-05-SS	5/16" Flange Nut SS	2
3	330-05	5/16" Flat Washer	2
4	380-1013	1/2" U-bolt Kit - fits 6" x 18" tube - (6" opening) includes flange nuts	2
5	380-1036	1/2" U-bolt Kit - fits 6" x 12" tube - (6" opening) includes flange nuts.	2
6	400-51631	Great Plains Gauge Extension / Section Valve Mounting Bracket	1


Step 1

Note: Not all U-bolts will be used.

- 1. Mount 400-5163Y1 bracket on hitch as shown, using two (2) 6" x 12" U-bolts and flange nuts in kit 380-1013.
- 2. Mount the gauge bracket to 400-5163Y1 as shown, using two (2) 5/16" x 1" hex head bolts, washers, and flange nuts.

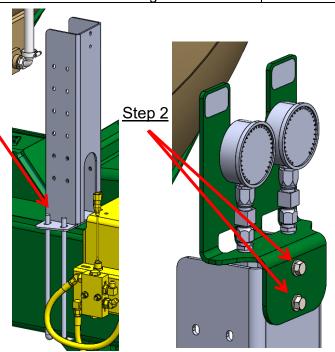

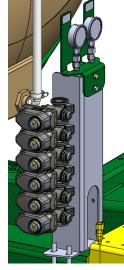

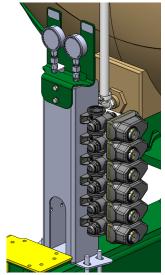

Section Valve options with Great Plains Tank.



Suggested Items


Kit Description: Great Plains BD7600 Tower/PumpRight Mounting Kit

Kit Number: 515-203400


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	300-060108-5	3/8" x 1-1/2" Hex Head Bolt - G5	7
2	300-080108-5	1/2" x 1-1/2" Hex Head Bolt - G5	4
3	323-06	3/8" Flat Washer	7
4	323-08	1/2" Flange Nut	4
5	330-06	3/8" Flat Washer	7
6	330-08	1/2" Flat Washer	4
7	384-1080	Hardware Kit - Qty 4 of 3/8" Carriage Bolts	1
/		and 3/8" Flange nuts for mounting Tower	
8	400-4996Y1-GN	Great Plains Side of Cradle Tower/PumpRight	1
		Mounting Bracket	I

Mounting Instructions:


- Mount 400-4996Y1 pump mounting bracket to the front or either side of BD7600 26 Foot 400 Gallon Tank Mount (450-5093Y1) using seven (7) 3/8" x 1-1/2" hex head bolts, washers, and flange nuts.
- 2. Mount Tower/PumpRight using the hardware provided in kit.

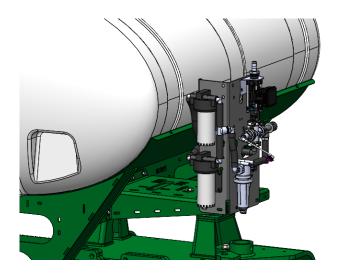

Step 1

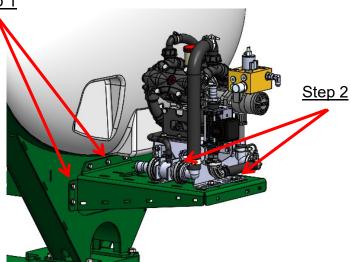

Orientation of pump may vary from shown.

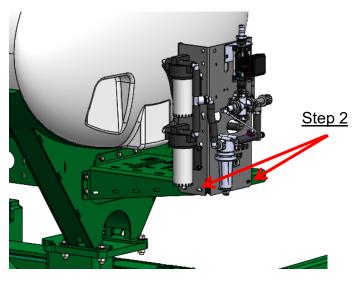

Page 6 © 2022 SurePoint Ag Systems, Inc.



Suggested Items


Kit Description: Great Plains BD7600 Tower Mounting Kit

Kit Number: 511-1012


ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	410-4213Y1	Great Plains BD7600 Series Drill Tower	1
ļ		Mount Bracket	
2	380-1036	1/2" U-Bolt Kit - Fits 6" x 12" Tube	2
3	380-1013	1/2" U-Bolt Kit - Fits 6" x 18" Tube	2
4	384-1080	Hardware Kit - Qty 4 of 3/8" Flange nuts for	1
4		mounting Tower	

Tower Mounting Instructions:

- 1. Mount 410-4213Y1 on hitch between toolbox and tank using hardware provided in 380-1036 or 380-1013.
- 2. Mount Tower on front face of 410-4213Y1 bracket using hardware provided in kit 384-1080 as shown.

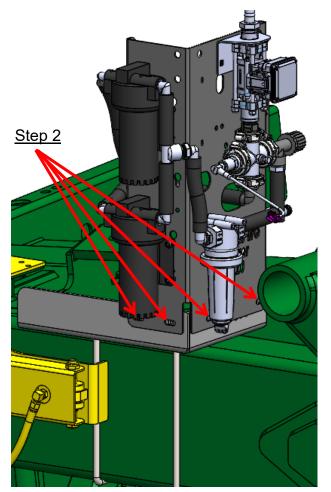

Step 1

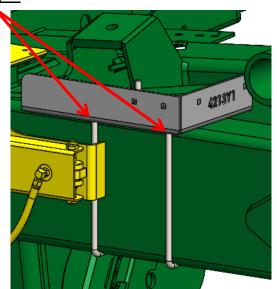

396-5098Y1 - Great Plains BD7600-26 Mounting Instruction Sheet


Page 7 © 2022 SurePoint Ag Systems, Inc.




BD7600 Fill/Discharge Kit

Kit Number: 555-101450

Kit Description: Great Plains BD7600 Series Drill 1-1/2" Fill/Discharge Kit (Tower)

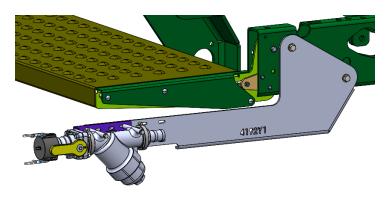

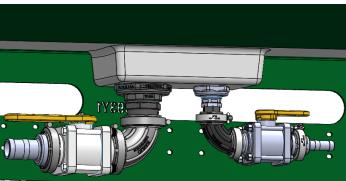


Note: Not all parts may be used.

	,		
ITEM NO.	PART NUMBER	DESCRIPTION	QTY.
1	102-200MVCF	2" Manifold Standard Port Poly Valve	1
2	102-100MVCF	1" Manifold Full Port Poly Valve	1
3	102-200VSFCF	200 Series Manifold x 2" Male Quick Coupler Standard Port Poly Valve	1
4	105-100075BRB	1" Manifold x 3/4" HB	1
5	105-100075MPT	1" Manifold x 3/4" MPT	1
6	105-100SWP90	1" Manifold Sweep - 90 Degree	1
7	105-100G-H	1" EPDM Manifold Gasket	3
8	105-150G-H	1-1/2" EPDM Manifold Gasket for 200 Series Manifold fittings	6
9	105-200100CPG	2" Manifold x 1" - Reducer Coupling	1
10	105-200100TEE	2" Manifold x 1" Manifold Tee	1
11	105-200125MPT	2" Manifold x 1-1/4" MPT	1
12	105-200MPT	2" Manifold x 2" MPT	2
13	105-200SWP90	2" Manifold Sweep - 90 Degree	1
14	105-FC100	1" Manifold Clamp	3
15	105-FC200	2" Manifold Clamp	6
16	106-200CAP	2" Cap	1
17	109-200MLS-20M	2" Manifold Y Strainer - 20 Mesh w/ 5/16" bolt holes for mounting	1
18	280-150-ENF	1-1/2" Enforcer Fertilizer Solution Hose	20
19	300-050100-5	5/16" x 1" Hex Head Bolt - G5	2
20	300-050600-5	5/16" x 6" Hex Head Bolt - G5	2
21	300-080408-5	1/2" x 4-1/2" Hex Head Bolt - G5	2
22	321-08	1/2" Nylock Nut	2
23	323-05	5/16" Flange Nut	2
	330-05	5/16" Flat Washer	4
25	330-08	1/2" Flat Washer	4
26	350-TC181	Pressure Seal HD Clamp, Size 238 (fits 1 1/4" - 1 1/2" Enforcer, Wire	2
	330-10101	Braided or AG200)	
	400-2605Y1-BK	Universal Fill Kit Strainer/ Valve Mount bracket - Black	1
28	450-4192Y1-GN	Fill Kit Bracket - Great Plains Drill	1



Fill Kit Strainer Assembly

- 1. Mount 410-4192Y1 bracket to the outside right portion of the center box on the holes as shown, using two (2) 1/2" x 4-1/2" hex head bolts, washers, and flange nuts.
- 2. Mount the male quick coupler valve to the 400-2605Y1 bracket by removing the nuts and lock washers on the valve and re-assembling.
- 3. Mount the 400-2605Y1 and strainer assembly to the 410-4192Y1 Fill Kit bracket using two (2) 5/16" x 6" hex head bolt, washers, and flange nuts.
- 4. Assemble the rest of the plumbing fittings as shown and route hose to tank valve assembly.

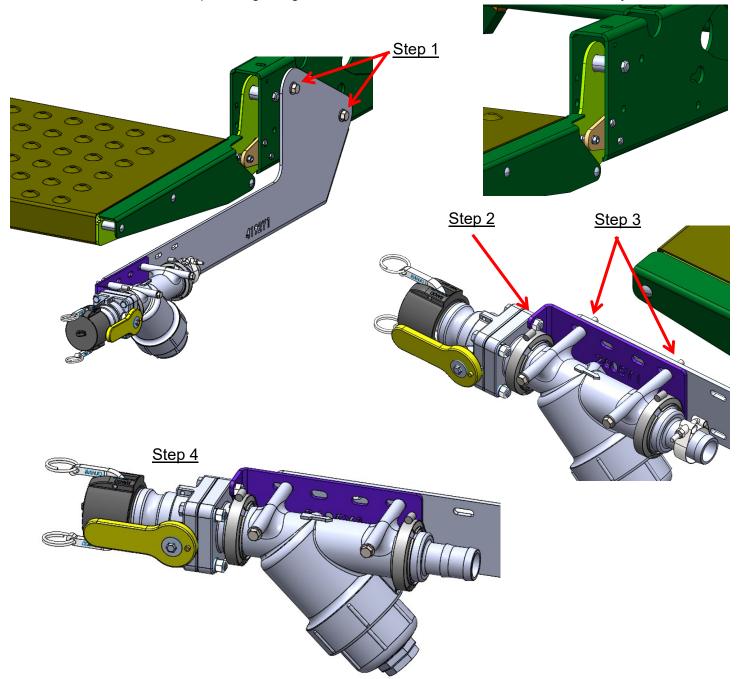


Page 9 © 2022 SurePoint Ag Systems, Inc.




Tank Valve / Discharge Assembly - For SurePointTank & Tower

- 1. Thread the correct size manifold flange x MPT fitting into the bottom of the tank.
- 2. Assemble plumbing fittings as shown, using manifold clamps and gaskets.
- 3. Route 1-1/2" hose from the tank to the fill kit strainer assembly and 3/4" discharge hose from the tank to the Tower located in front of the tank, check for fold clearance and secure as necessary.

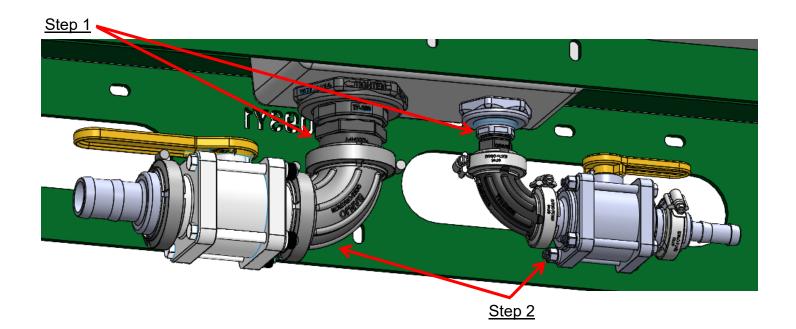


Step 3

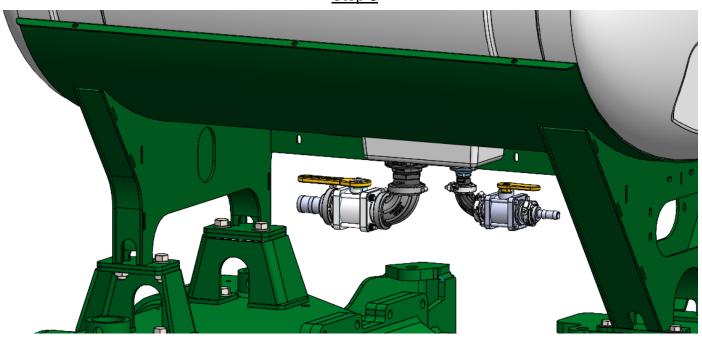




Tank Valve / Discharge Assembly - For Great Plains Tank & Tower

- 1. Thread the correct size manifold flange x MPT fitting into the bottom of the tank.
- 2. Assemble plumbing fittings as shown, using manifold clamps and gaskets.
- 3. Route 1-1/2" hose from the tank to the fill kit strainer assembly and 3/4" discharge hose from the tank to the Tower located in front of the tank. Check for fold clearance and secure as necessary.

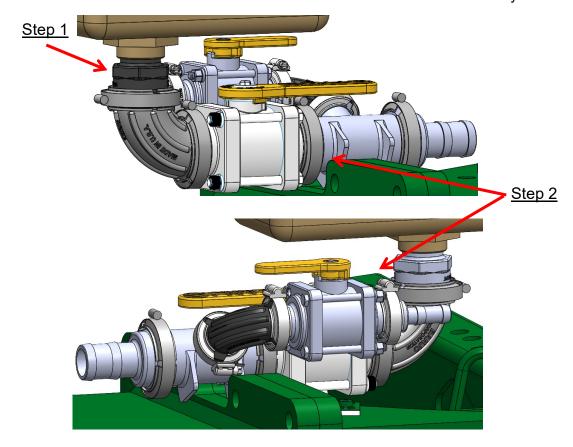

Step 3

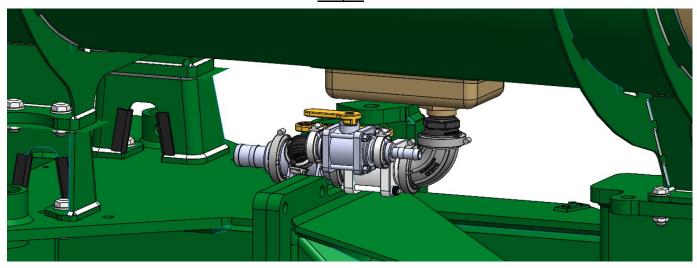




BD7600 Fill/Discharge Kit

Kit Number: 555-101475

Kit Description: Great Plains BD7600 Series Drill 1-1/2" Fill/Discharge Kit (PumpRight)

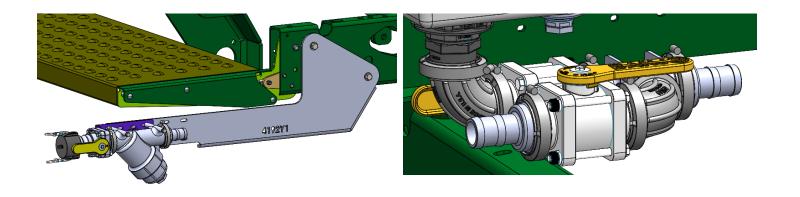


Note: Not all parts may be used.

ITEM	PART NUMBER	DESCRIPTION	QTY.
1	100-075PLUG	3/4" Pipe Plug	1
2	102-200MVCF	2" Manifold Standard Port Poly Valve	2
3	102-200VSFCF	200 Series Manifold x 2" Male Quick Coupler Standard Port Poly Valve	1
4	105-150G-H	1-1/2" EPDM Manifold Gasket for 200 Series Manifold fittings	9
5	105-200125BRB	2" Manifold x 1-1/4" HB	1
6	105-200125MPT	2" Manifold x 1-1/4" MPT	1
7	105-200150BRB	2" Manifold x 1-1/2" HB	3
8	105-200MPT	2" Manifold x 2" MPT	2
9	105-200SWP90	2" Manifold Sweep - 90 Degree	2
10	105-200TEE	2" Manifold Tee	1
11	105-FC200	2" Manifold Clamp	9
12	106-200CAP	2" Cap	1
13	109-200MLS-20M	2" Manifold Y Strainer - 20 Mesh w/ 5/16" bolt holes for mounting	1
14	280-150-ENF	1-1/2" Enforcer Fertilizer Solution Hose	20
15	300-050100-5	5/16" x 1" Hex Head Bolt - G5	2
16	300-050600-5	5/16" x 6" Hex Head Bolt - G5	2
17	300-080408-5	1/2" x 4-1/2" Hex Head Bolt - G5	2
18	321-08	1/2" Nylock Nut	2
19	323-05	5/16" Flange Nut	2
20	330-05	5/16" Flat Washer	4
21	330-08	1/2" Flat Washer	4
22	350-TC181	Pressure Seal HD Clamp, Size 238 (fits 1 1/4" - 1 1/2" Enforcer, Wire	2
		Braided or AG200)	
	400-2605Y1-BK	Universal Fill Kit Strainer/ Valve Mount bracket - Black	1
24	450-4192Y1-GN	Fill Kit Bracket - Great Plains Drill	1




Tank Valve / Discharge Assembly - For SurePointTank & PumpRight

- 1. Thread the correct size manifold flange x MPT fitting into the bottom of the tank. Plug opening not in use.
- 2. Assemble plumbing fittings as shown, using manifold clamps and gaskets.
- 3. Route 1-1/2" hose from the tank to the fill kit strainer assembly and 1-1/4" or 1-1/2" discharge hose from the tank to the PumpRight located in front of the tank. Check for fold clearance and secure as necessary.

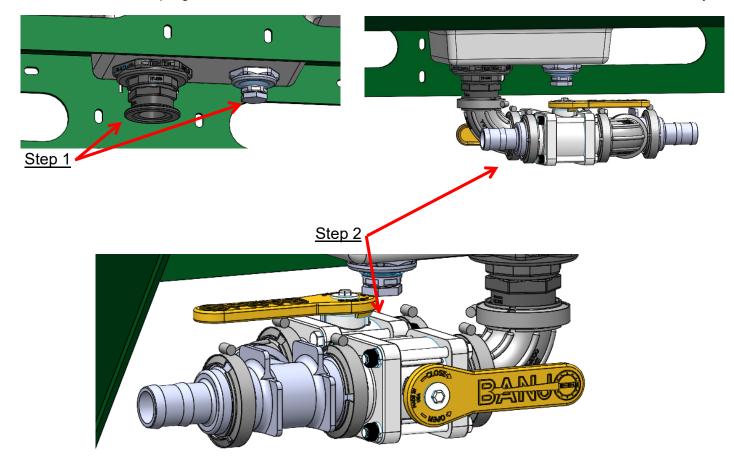


Step 3

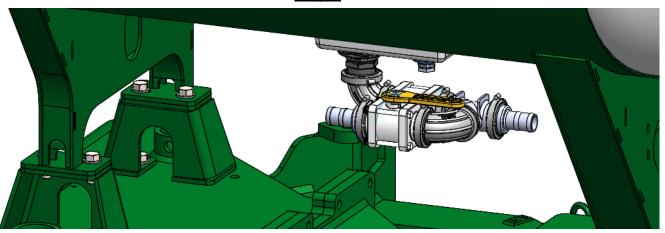




Tank Valve / Discharge Assembly - For Great Plains Tank & PumpRight

- 1. Thread the correct size manifold flange x MPT fitting into the bottom of the tank.
- 2. Assemble plumbing fittings as shown, using manifold clamps and gaskets.
- 3. Route 1-1/2" hose from the tank to the fill kit strainer assembly and 1-1/4" or 1-1/2" discharge hose from the tank to the Tower located in front of the tank. Check for fold clearance and secure as necessary.

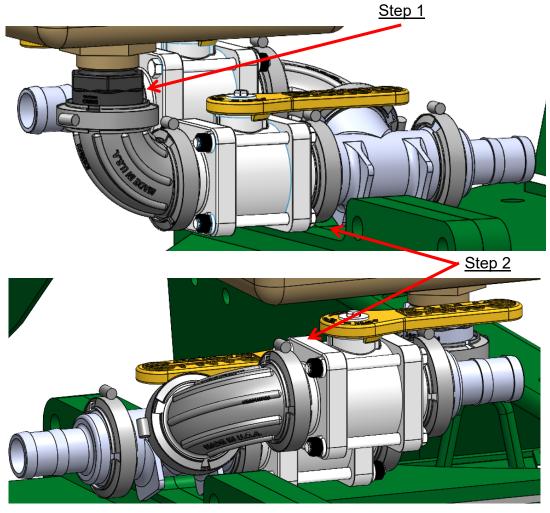

Step 3

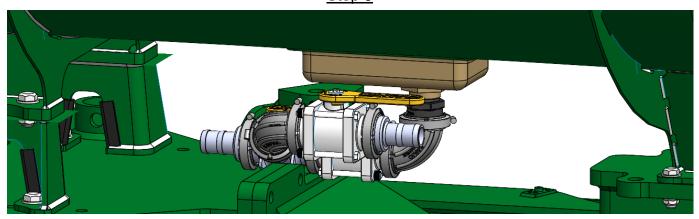

396-5098Y1 - Great Plains BD7600-26 Mounting Instruction Sheet

Page 14 © 2022 SurePoint Ag Systems, Inc.